

TECHNICAL INFORMATION N°2005 - 26


Chassis : 29DM182 (ITC008)

Symptom / Problem observed :

The set switches in security mode when the picture content changes (mainly on a white picture).

Solution :

-Change RZ07 resistor from 27.4KΩ to 29.4KΩ 1% 0.250W (**PART No 60442370**).

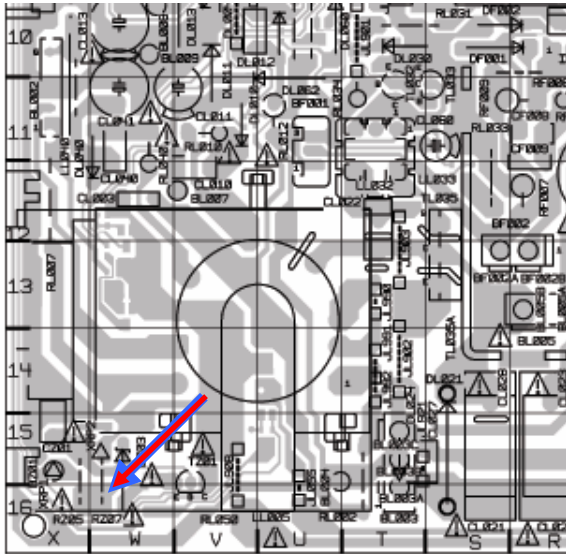

IRIS Code : The code mentioned below must be used to report the failure on the warrantee claims form; we have included it to make fault report easier and the data more reliable.

Symptom	Part code number	Qty	Position	Section	D.Code	R.Code
1 1 1 0	6 0 4 4 2 3 7 0	0 1	R Z 0 7	D F L	Y	A

You do not need to write anything in the white boxes.