



User's Manual

ND 710 ND 750

Position Display Units for Milling Machines

9/2000

Position display (ND 710 only two axes) • Select coordinate axes

(ND 710 only X and Y)

• Select axis-specific operating parameters





This manual is for the ND display units with the following software numbers or higher:

ND 710 for two axes	246	271-06
ND 750 for three axes	246	271-06

About this manual

This manual is divided into two parts:

Part I: Operating Instructions

- Fundamentals of positioning
- ND functions

Part II: Installation and Specifications

- Mounting the display unit on the machine
- Description of operating parameters

Part I Operating Instructions

Fundamentals	4
Switch-On, Traversing the Reference Points	9
Datum Setting	10
Tool Compensation	19
Moving the Axes with Distance-To-Go	20
Bolt Hole Circles and Bolt Hole Circle Segments	22
Linear Hole Patterns	25
Working with a Scaling Factor	28
Error Messages	29
Part II	
Installation and	
Specifications Pa	ge 31

Fundamentals

Fundamentals

You can skip this chapter if you are already familiar with coordinate systems, incremental and absolute dimensions, nominal positions, actual positions and distance-to-go.

Coordinate system

To describe the geometry of a workpiece, the *Cartesian*^{*} coordinate system is used. The Cartesian coordinate system consists of three mutually perpendicular axes X, Y and Z. The point of intersection of these axes is called the **datum** or origin of the coordinate system.

Think of the axes as scales with divisions (usually in millimeters) which allow us to fix points in space referenced to the datum.

To determine positions on a workpiece, the coordinate system is "laid" onto the workpiece.

The machine axes are parallel to the axes of the coordinate system. The Z axis is normally the tool axis.





¹⁾ Named in honor of the French mathematician and philosopher René Descartes (1596 to 1650)

Datum setting

The workpiece drawing is used as the basis for machining the workpiece. To enable the dimensions in the drawing to be converted into traverse distances of machine axes X, Y and Z, each drawing dimension requires a datum or reference point on the workpiece (since a position can only be defined in relationship to another position).

The workpiece drawing always indicates **one** absolute datum (the datum for absolute dimensions). However, it may contain additional relative datums.

In the context of a numerical position display unit, *datum setting* means bringing the workpiece and the tool into a defined position in relation to each other and then setting the axis displays to the value which corresponds to that position. This establishes a fixed relationship between the actual positions of the axes and the displayed positions.

You can set 2 absolute datum points and store them in nonvolatile memory.



Absolute workpiece positions

Each position on the workpiece is uniquely defined by its absolute coordinates.

Fxam	n	le
Lланн	μ	

Absolute coordinates of position ①:

Х	=	10 mm
Υ	=	5 mm
Ζ	=	0 mm

If you are working according to a workpiece drawing with absolute dimensions, then you are moving the tool **to** the coordinates.

Relative workpiece positions

A position can also be defined relative to the previous nominal position. The datum for the dimension is then located at the previous nominal position. Such coordinates are termed **relative coordinates** or chain dimensions. Incremental coordinates are indicated by a preceding **I**.

Example

Relative coordinate of position ② referenced to position ①:

IX = 10 mm IY = 10 mm

If you are working according to a workpiece drawing with incremental dimensions, then you are moving the tool **by** the dimensions.

Sign for incremental dimensioning

A relative dimension has a **positive** sign when the axis is moved in the positive direction, and a **negative** sign when it is moved in the negative direction.





Fundamentals

Nominal position, actual position and distance-to-go

The position to which the tool is to move is called the **nominal** position (\mathbb{S}). The position at which the tool is actually located at any given moment is called the **actual** position (\mathbb{O}).

The distance from the nominal position to the actual position is called the distance-to-go (\mathbf{R}) .

Sign for distance-to-go

When you are using the distance-to-go display, the nominal position becomes the relative datum (display value 0). The distance-to-go is therefore negative when you move in the positive axis direction, and positive when you move in the negative axis direction.



Position encoders

The position encoders on the machine convert the movements of the machine axes into electrical signals. The ND display unit evaluates these signals, determines the actual position of the machine axes and displays the position as a numerical value.

If the power is interrupted, the relationship between the machine axis positions and the calculated actual positions is lost. The reference marks on the position encoders and the REF reference mark evaluation feature enable the ND to quickly re-establish this relationship again when the power is restored.



Reference marks

The scales of the position encoders contain one or more reference marks. When a reference mark is crossed over, a signal is generated which identifies that position as a reference point (scale datum = machine datum).

When this reference mark is crossed over, the ND's reference mark evaluation feature (REF) restores the relationship between axis slide positions and display values which you last defined by setting the datum. If the linear encoders have **distance-coded** reference marks, you only need to move the machine axes a maximum of 20 mm to do this.



Switch-On, Traversing the Reference Marks



Turn on power (switch located on rear panel). REF and decimal points in status display blink.

ENT...CL



Confirm reference traverse mode. REF remains on continuously. Decimal points blink.



Cross over the reference marks in all axes (in any sequence). Each axis display becomes active when its reference mark is crossed over.

Crossing over the reference marks stores the last relationship between axis slide positions and display values for datum points 1 and 2 in nonvolatile memory.

Note that if you choose *not* to traverse the reference marks (by clearing the dialog ENT ... CL with the CL key), this relationship will be lost if the power is interrupted or when the unit is switched off.



If you wish to use multipoint axis error compensation you must traverse the reference marks (see "Multipoint axis error compensation")!

Datum Setting



If you want to save the datum points in nonvolatile memory, you must first cross over the reference marks.

Only after crossing over the reference marks can you set new datums or activate existing ones.

In P70, you can select:

- Two datum points: The selected datum is displayed via <u>1</u> or <u>2</u>
- Nine datum points: The selected datum is displayed in the lowest axis via d1 to d9.

There are several ways to set datums:

Touch the edge of the workpiece with the tool and then set the desired datum. You can also touch two edges and set the centerline between them as a datum, or touch the inside of a circle and set the circle center as a datum (see examples). The tool data of the tool used for this are automatically considered (see "Tool Compensation"). To call a datum point you have set, proceed as follows:

You have set two datum points in P70:



Select datum 1 or 2.

You have set nine datum points in P70:



Datum Setting

Probing a workpiece edge to find a datum

The ND display units support the following probing functions:

- "PROBE EDGE" Setting a workpiece edge as datum.
- "PROBE MIDPOINT" Setting a midpoint between two workpiece edges as datum.
- "PROBE CIRCLE" Setting the center of a circle as datum.

The probing functions are accessible in the SPEC FCT mode of operation.

The functions "PROBE EDGE", "PROBE MIDPOINT" and "PROBE CIRCLE" are described on the following pages.

Datum setting with the tool

Example:

Working plane	X / Y
Tool axis	Z
Tool radius	R = 5 mm
Axis sequence for datum setting	X – Y – Z



Probing a workpiece edge to find a datum

		PROBE X (appea	ars only briefly))
	Select a datum number (see page 10).		Touch workpiece edge ① with the tool.
SPEC FCT	Select the special functions.	ENT	X position is captured. "SET edge" appears briefly. SET starts to blink.
SPEC FCT Or	Select "probing function."		Retract tool from workpiece. The I<- status symbol lights.
			_
PROBING	Confirm selection.	O ENT	Enter position value for the datum. Tool radius is automatically compensated.
PROBE EDGE	Confirm "Probe edge."	Y	Y position is captured. SET lights. The I<- status symbol starts to blink.
		PROBE Y (appea	ars only briefly)
X	Select the X axis (if not already selected). SET lights. The I<- status symbol starts to blink.		Touch workpiece edge ② with the tool.
•	-		

0
-
- L
Ð
S
_
- C
5
un
tum
atum

Enter position value for the datum in the

After setting the datum, exit the

Z axis.

probing funtions.

	Y position is captured. "SET edge"appears briefly. SET starts to blink. Retract tool from workpiece. The I<- status symbol lights.	SPEC OF CL
	Enter position value for the datum in the Y axis. Tool radius is automatically compensated.	
Z	Select the Z axis. SET lights. The I<- status symbol starts to blink.	1)
PROBE Z (appears	only briefly)	
	Touch workpiece surface with the tool.	
	Z position is captured. "SET edge" appears briefly. SET starts to blink. Retract tool from workpiece. The I<- status symbol lights.	

Probing workpiece edges to find a midpoint datum

The edges to be probed run parallel to the Y axis.

Follow the procedure below for all midpoints between two edges:









Select the probing function.



		•	
PROBE EDGE			Retract tool from workpiece.
1/2 or	Select "Probe midpoint."	l 🚱	
PROBE MIDP.		(2ND POS X (app	pears only briefly)
ENT	Confirm "Probe midpoint." SET lights.		Touch workpiece edge ② with the tool.
X ENT	Select the X axis (if not already selected)		
	starts to blink.	ENT	"SET MIDPOINT" appears briefly. SET starts to blink. Retract tool from
IST POS X (ap)	pears only briefly)		to blink
A	Touch workpiece edge ① with the tool.		
<u>e</u>		26	Enter position value for the midpoint between the two edges, e.g. 26.
~			
ENT	Position value () is captured.	SPEC OF CL	Exit the probing functions.

- •
- -
- •
- •

Probing the inside of a circle to set its center as datum

To determine the circle center, the tool must probe four points. The points to be probed are located in the X-Y plane.











Select the probing function.

PROBING	
ENT	Confirm selection.
PROBE CTRC	





_
-
- L
a
()
Ξ
Ξ
E
m
tum
Itum
atum
atum
Datum



- •
- •
- .
- •

4тн роз у (арреа	ars only briefly)
	Touch workpiece at position ④ with the tool.
ENT	Position (4) is captured. "CENTER X" appears briefly. Status display SET starts to blink in the X axis.
26	Enter position value for the X coordinate of circle center, e.g. 26. "CENTER Y" appears briefly. Status display SET starts to blink in the Y axis.
0 ENT	Enter position value for the Y coordinate of circle center, e.g. 0.



Exit the probing functions.

Tool Compensation

You can enter the axis, length and diameter of the current tool.



TOOL DATA	
ENT	Confirm tool data input mode.

TOOL DIAM.	
20	Enter the tool diameter, e.g. 20 mm, and confirm with ENT.

TOOL LENGTH



¹⁾ only with ND 750

Enter the tool length, e.g. 50 mm, and confirm with ENT.

1)



Moving the Axes with Distance-To-Go Display

Normally, the display shows the actual position of the tool. However, it is often more helpful to display the distance remaining to the nominal position (the distance-to-go). You can then position simply by moving the axis until the display value is zero.

You can enter the absolute coordinates in the distance-to-go display. An active radius compensation will be considered.

Example: Milling a shoulder with distance-to-go



Select the special functions.

DELTA MODE



Confirm your selection, the Δ symbol lights.



Select the axis, enter the nominal value, e.g. 20 mm, select radius compensation R+, confirm with ENT.





Move the machine axis to zero ①.



Select the axis, enter the nominal value, e.g. 30 mm, select radius compensation R–, and confirm with ENT.



Move the machine axis to zero ②.



Select the axis, enter the nominal value, e.g. 50 mm, select radius compensation R+, confirm with ENT.



Move the machine axis to zero 3.



If appropriate, switch off the distance-to-go display.

Bolt Hole Circles and Bolt Hole Circle Segments

Your display unit enables you to quickly and easily drill bolt hole circles and bolt hole circle segments. The required data is requested in the message field.

Each hole can be moved to by traversing to display value zero. This requires entry of the following data:

- Number of holes (maximum: 999)
- Circle center
- Circle radius
- Starting angle for first hole
- Angle step between the holes (only for circle segments)
- Hole depth

Example

Number of holes	8
Coordinates of the center	X = 50 mm
	Y = 50 mm
Circle radius	20 mm
Starting angle	30 degrees
Hole depth	Z = –5 mm



S
۲Ľ.
5
e
2
<u> </u>
O
Ð
S
<u></u>
<u> </u>
5
U
Ð
-
0
T
±.
0
m
-
ŝ
ă
O
.=
C
e
0
Ť
- L
-
0
m



HOLE DEPTH 1) Z 5 Enter the total hole depth, e.g. -5 mm, and confirm with ENT.

START



Start the display of the hole positions.



After the start, the distance-to-go mode becomes active (the Δ symbol lights). The hole number is shown briefly in the X axis. The individual holes are reached by traversing to zero. The holes can be selected with the ENT key or the <u>11</u> <u>12</u> key. The minus key shows the hole number again.



Exit the bolt hole circle function.

¹⁾ only with ND 750

Linear Hole Patterns

The linear hole pattern feature allows you to easily create rows of holes to cover an area. The required data are requested in the message field.

You can position to each hole by traversing to display value zero. The following data are required:

- Coordinates of the first hole
- Number of holes per row (maximum: 999)
- Spacing between holes
- Angle between the rows and the reference axis
- Hole depth
- Number of rows (maximum: 999)
- Spacing between rows

Example

Coordinates of the first hole	X = 20 mm
	Y = 15 mm
Number of holes per row	4
Spacing between holes	16 mm
Angle	15 degrees
Hole depth	Z = -30 mm
Number of rows	3
Spacing between rows	20 mm



rns	
Patte	SPEC
ar Hole	LIN.
Line	
	1ST H

Select the special functions.

or the select "hole pattern."



SPEC FCT

Confirm "linear hole" pattern.

1ST HOLE X

2 0 ENT

Enter the X coordinate of the first holes, e.g. 20, and confirm with ENT.

1ST HOLE Y

1 5 ENT

Enter the Y coordinate of the first holes, e.g. 15, and confirm with ENT.

- - .
- .



HOLES ROW



Enter the number of holes per row, e.g. 4, and confirm with ENT.

HOLE SPACE



Enter the spacing between holes in the row, e.g. 16, and confirm with ENT.

ANGLE



Enter the angle, e.g. 15 degrees, and confirm with ENT.

HOLE DEPTH



Enter the hole depth, e.g. –30 mm, and confirm with ENT.

NUMBER ROW



Enter the number of rows, e.g. 3, and confirm with ENT.

ROW SPACE



Enter the spacing of the rows, e.g. 20, and confirm with ENT.

START	
ENT	Start the display of hole positions.

The distance-to-go mode is now active (the Δ symbol lights). The hole number is shown briefly in the X axis. Move to the individual hole positions by traversing to the display value zero. Hole can be selected with the ENT key or with the 1112 key Pressing the minus key shows the
the 1^{2} key. Pressing the minus key shows the
hole number again.



Exit the linear hole patterns function.

Working with a Scaling Factor

Scaling factors enable you to increase or decrease the display values based on the actual traverse distance. The display values are changed symmetrically about the datum.

Enter scaling factors separately for each axis in parameter P12.

Parameter P11 activates and deactivates the scaling factors in all axes (see "Operating Parameters").

Example for enlarging a workpiece:

P12.1	3.5
P12.2	3.0
P11	ON

This results in a larger workpiece as shown in the illustration at right: ① is the original size, ② is with axis-specific scaling factors.

If a scaling factor is active, SCL lights in the status display.



Error Messages

Message	Cause and effect	
SIGNAL X	Encoder signal is too small,	
	e.g. when an encoder is	
	contaminated.	
PROB. ERROR	Before touching off on the	
	workpiece, the tool must move	
	by a distance of at least 0.2 mm.	
ERR. REF. X	The spacing of the reference	
	marks as defined in P43 is not	
	the same as the actual spacing.	
FRQ. ERR. X	The input frequency for this	
	encoder input is too high. This	
	can occur when the scale is	
	moved too fast.	
ERR. MEMORY	Check sum error: Check the	
	datum, operating parameters and	
	compensation values for multi-	
	point axis error compensation.	
	If the error recurs, contact your	
	service agency!	

To erase error messages:

After you have removed the cause of error:▶ Press the CL key.

Part II Installation and Specifications

Items Supplied	32
Connections on Rear Panel	33
Mounting	34
Power Connection	34
Connecting the Encoders	35
Operating Parameters Entering/changing operating parameters Operating parameter list	36 36 37
Linear Encoders Setting the display step Display step, signal period, and subdivision Parameter settings for HEIDENHAIN linear encoders with 11 µApp	39 39 39 40
Multipoint Axis Error Compensation	41
Specifications Dimensions of the ND 710/ND 750	44 45

Items Supplied

• ND 710 for 2 axes

or

- ND 750 for 3 axes
- Power connector Id. Nr. 257 811-01
- User's Manual

Optional Accessories

• **Tilting base** for housing bottom Id. Nr. 281 619-01

щ



Mounting

ND 710/ND 750

To mount the display unit on a support, use the M4 threaded holes in the rubber feet. You can also mount the display unit on the optional tilting base.



Power Connection

Power leads: 0 and 0Connect protective ground to 1!**Power supply:** 100 Vac to 240 Vac (-15 % to +10 %) 50 Hz to 60 Hz (± 2 Hz)

A voltage selector is not necessary.

4

Ш

• Danger of electrical shock!

- Connect a protective ground. This connection must never be interrupted.
- Unplug the power cord before opening the housing.

To increase the noise immunity, connect the ground terminal on the rear panel to the central ground point of the machine. (Minimum cross-section: 6 mm²).



Connecting the Encoders

Connecting the Encoders

Your display unit will accept all HEIDENHAIN linear encoders with sinusoidal output signals (7 to 16 μA_{pp}) and distance-coded or single reference marks.

Assignment of the encoder inputs

Encoder input X1 is for the X axis. Encoder input X2 is for the Y axis. Encoder input X3 is for the Z axis (ND 750 only).

Encoder monitoring system

Your display unit features a monitoring system for checking the amplitude and frequency of the encoder signals. If it detects a faulty signal, one of the following error messages will be generated:

SIGNAL X FRQ. X

Encoder monitoring can be activated with parameter P45.

If you are using linear encoders with distance-coded reference marks, the encoder monitoring system also checks whether the spacing of the reference marks as defined in parameter P43 is the same as the actual spacing on the scales. If it is not, the following error message will be generated:

ERR. REF. X



Operating Parameters

Operating parameters allow you to modify the operating characteristics of your display unit and define the evaluation of the encoder signals. Operating parameters that can be changed by the user are called user parameters, and can be accessed with the SPEC FCT key and the dialog "PARAMETER" (user parameters are identified as such in the parameter list). The full range of parameters can only be accessed through the dialog "CODE" and by entering 95148. Operating parameters are designated by the letter P and a number. Example: **P11.** The parameter designation is shown in the input field when you select it with the DATUM and ENT key in the X display.

Some operating parameters have separate values for each axis. In the **ND 750**, these parameters are identified by an index of 1 to 3, and in the **ND 710** by an index of one to two. **Example:** P12.1 scaling factor, X axis P12.2 scaling factor, Y axis P12.3 scaling factor, Z axis (ND 750 only)

The operating parameters are preset before the unit leaves the factory. These factory settings are indicated in the parameter list in **boldface type**.

Entering and changing operating parameters

To access the operating parameters

- Press the SPEC FCT key.
- Press the SPEC FCT key or <u>1</u> 2, until "PARAMETER" appears in the X display.
- Confirm your selection by pressing "ENT."

To select protected operating parameters

- Press the 1 | 2 key to select user parameter P00 CODE.
- Enter the code number 95148.
- ► Confirm with "ENT."

To page through the operating parameters

- > Page forwards by pressing the ENT key.
- > Page backwards by pressing the 1 2 key.

To change parameter settings

 Press the minus key or enter the value and confirm with the ENT key.

To correct an entry

 Press CL: the old value reappears in the input line and becomes effective again.

To leave the operating parameters

► Press the SPEC FCT or CL key.

List of operating parameters

P00 CODE	Enter the code number	r:
9 51 48:	Change protected ope	erating parameters
66 55 44:	Display the software v	version (X display)
	Display date of release	e (Y display)
10 52 96:	Multipoint axis error compensation	
P1 Unit of	measure 1)	
Display in r	nillimeters	MM
Display in ir	nches	INCH
P3.1 to P3.3	8 Radius/diameter disp	play ¹⁾
Display pos	ition value as radius	RADIUS
Display pos	ition value as diameter	DIAMETER
P11 Activa	ate scaling factor 1)	
Active		SCALING ON

P12.1 to P12.3 Define scaling factor 1)

Enter a scaling factor separately for each axis: Entry value > 1: workpiece will "grow" Entry value = 1: workpiece will remain the same size Entry value < 1: workpiece will "shrink" Input range: 0.100000 to 9.999999 Factory default setting: **1.000000**

P30.1 to P30.3 Counting direction Positive counting direction with positive direction of traverse DIRECT, POS Negative counting direction with positive direction of traverse DIRECT. NEG P31.1 to P31.3 Signal period of the encoder Input range: 0.0000001 to 99999.9999 µm Default setting: 20 µm P33.1 to P33.3 Counting mode 0 - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 90 - 2 - 4 - 6 - 8 0 - 5 P38.1 to P38.3 Decimal places 1/2/3/4 (up to 6 with inch display) P40.1 to P40.3 Select type of axis error compensation No axis error compensation CORR. OFF Linear error compensation active. multipoint error comp. not active CORR. LIN Multipoint error compensation active, linear error compensation not active CORR. ABS

P41.1 to P41.3 Linear axis error compensation

Input rang	e (µm):	-99999 to +99999				
Factory de	efault setting:	0				
Example:	Displayed length	L _a = 620.000 mm				
	Actual length (as detern	nined for example with				
	the VM 101 from HEIDE	NHAIN)				
		L _t = 619.876 mm				
	Difference	$DL = L_t - L_a = -124 \ \mu m$				
	Compensation factor k:					
	k = ΔL/L _a = – 124 μm/0.62 m = – 200 [μm/m]					
D/2 1 to E	12.2 Reference marks					

P43.1 to P43.3 Reference marks

One reference mark	SINGLE REF.M.			
Distance-coded with 500 • SP	500	SP		
Distance-coded with 1000 • SP	1000	SP		
Distance-coded with 2000 • SP	2000	SP		
Distance-coded with 5000 • SP	5000	SP		
(SP: signal period)				

P44.1 to P44.3 Reference mark evaluation

Evaluation	REF.	х	ON
No evaluation	REF.	Х	OFF

P45.1 to P45.3 Encoder monitoring

Amplitude and frequency		
monitoring	ALARM	ON
No monitoring	ALARM	OFF

P48.1 to P48.3 Activate axis display Axis display active AXIS ON Not active AXIS OFF P70 Number of datums 2 datums 2 DATUMS 9 datums 9 DATUMS Function of the CL key Reset to zero with CL CL...RESET No reset to zero with Cl CL....OFF P81 Function of the R+/- key The R+/- key divides the actual R + / - 1/2value by two No division of the actual value R+/- OFF **P98** Dialog language ¹⁾ German LANGUAGE D English LANGUAGE GB French LANGUAGE F Italian LANGUAGE Ι Dutch LANGUAGE NL Spanish LANGUAGE Ε Danish LANGUAGE DK Swedish LANGUAGE S Finnish LANGUAGE FI Czech LANGUAGE CZ Polish LANGUAGE PL Hungarian LANGUAGE H Portuguese LANGUAGE P

Linear Encoders

Selecting the display step with linear encoders

To select a certain display step, you must define the following operating parameters:

- Signal period (P31)
- Counting mode (P33)
- Decimal places (P38)

Example

Linear encoder with a signal period of 10 μm

Desired display step 0.000 5 mm Signal period (P31) 10 Counting mode (P33) 5 Decimal places (P38) 4

The following tables will help you select the parameters.

Parameter settings for HEIDENHAIN linear encoders with 11 $\mu A_{_{PP}}$ signals

Model	-	Reference	Millimeters		Inches			
	Signalperiod [µm]	marks	Display step [mm]	d Count	Decimal places	Display step [inch]	Count	Decimal places
CT MT xx01	2	single	0.0005 0.0002	5 2	4 4	0.00002 0.00001	2 1	P 38 5 5
LIP 401A/401R		-/single	0.0001	1	4	0.000005	5	6
LF 103/103C LF 401/401C LIF 101/101C LIP 501/501C	4	single/5000	0.001 0.0005 0.0002	1 5 2	3 4 4	0.00005 0.00002 0.00001	5 2 1	5 5 5
MT xx	10	single	0.0005	5	4	0.00002	2	5
LS 303/303C LS 603/603C	20	single/1000	0.01 0.005	1 5	2 3	0.0005 0.0002	5 2	4 4
LS 106/106C LS 406/406C LS 706/706C ST 1201	20	single/1000	0.001	1	3	0.00005	5	5
LB 302/302C	40	single/2000	0.005	5	3	0.0002	2	4
LIDA 10x/10xC			0.002	2	3	0.0001	1	4
LB 301/301C	100	single/1000	0.005	5	3	0.0002	2	4

Example:

Your encoder: LS 303 C, desired display step: 0.005 mm (5 μ m), parameter settings: P01 = mm, P43 = 1 000, P32 = 4, P33 = 5, P38 = 3

Multipoint Axis Error Compensation



If you want to use the multipoint axis error compensation feature, you must

- activate this feature with operating parameter 40 (see "Operating Parameters"),
- traverse the reference marks after switching on the display unit,
- enter compensation value table.

Your machine may have a non-linear axis error due to factors such as axis sag or drivescrew errors. Such deviations are usually measured with a comparator measuring system (such as the HEIDENHAIN VM 101).

For example, you can determine the screw pitch error $X{=}\mathsf{F}(X)$ for the X axis.

An axis can only be corrected in relation to **one** axis that has an error. In each axis, a compensation value table with 64 compensation values can be generated. You can select the compensation table with the SPEC FCT key and the "PARAMETER\CODE" dialog.

To determine the compensation value (e.g. with a VM 101), the REF display must be selected after selecting the compensation-value table.



Select the REF.

The decimal point in the left display field indicates that the values displayed are referenced to the reference point. If the decimal point blinks, the reference marks have not been traversed.

Entries in the compensation value table

- Axis to be corrected: X, Y or Z (Z axis only with ND 750)
- Axis causing the error: X, Y or Z (Z axis only with ND 750)
- Datum for the axis to be corrected: Here you enter the point starting at which the axis with error is to be corrected. This point indicates the absolute distance to the reference point.
 - Do not change the datum point after measuring the axis error and before entering the axis error into the compensation table.
- Spacing of the compensation points The spacing of the compensation points is expressed as 2^x [µm].

Enter the value of the exponent x into the compensation value table.

Minimum input value: 6 (= 0.064 mm)

Maximum input value: 20 (= 8388.608 mm)

- **Example:** 900 mm traverse and 15 compensation points: results in 60.000 mm spacing between points. Nearest power of two: 2¹⁶ [μm] = 65.536 mm Entry in compensation value table: 16
- Compensation value

You enter the measured compensation value (in millimeters) for the displayed compensation point. Compensation point 0 always has the value 0 and cannot be changed.





28.024

SPEC FCT

or

Deleting a compensation value table

7	Enter all further compensation points. If	SPEC FCT	Select special functions.
12	you press the minus key, the unit will show the number of the current compensation point in the X display. Direct selection of compensation	SPEC Or 1/1/2	Select "parameter."
	with the number (two-digit) of the	PARAMETER	
	desired compensation point.		Select the dialog for entering the code number.
СІ	Conclude entry.		
		CODE	
		1052 96 m	Enter the code number 105296 and confirm with ENT.
			1
		AXIS X	
		ZCL	Select the compensation value table (e.g., for the Z axis), and delete the table.
		DELETE Z	
		ENT	Confirm with ENT, or cancel with CL.
		SPEC FCT	Conclude entry.

Specifications

Housing	ND 710/ND 750 Bench-top design, cast-metal housing Dimensions (W • H • D) 270 mm • 172 mm • 93 mm	Encoder inputs	For encoders with 7 to 16 µA _{PP} Grating period 2, 4, 10, 20, 40, 100, and 200 µm Reference mark evaluation for	
Oper. temperature	0° to 45° C (32° to 113° F)		distance-coded and single reference marks	
Storage temperature	–20° to 70° C (–4° to 158° F)	Input frequency	Max, 100 kHz for 30 m	
Weight	Approx. 2.3 kg (5 lb)	input nequency	cable length	
Relative humidity	<75% annual average <90% in rare cases	Display step	Adjustable (see "Linear Encoders")	
Power supply	100 Vac to 240 Vac (-15% to +10%)	Datums	2 (nonvolatile)	
	50 Hz to 60 Hz (± 2 Hz)	Functions	- Tool radius compensation	
Power consumption	15 W		– Distance-to-go display	
Protection	IP 40 as per IEC 529		 Touching off function with tool Circular & linear hole patterns 	

- Scaling factor

Dimensions mm/inches



Tilting base



HEIDENHAIN

DR. JOHANNES HEIDENHAIN GmbH

 Image: Service
 + 49/86 69/31-1272

 Image: TNC-Service + 49/86 69/31-1446

 Image: Applied transformation of the service of

http://www.heidenhain.de

HEIDENHAIN (G.B.) Limited

200 London Road, Burgess Hill West Sussex RH15 9RD, Great Britain (01444) 247711 (01444) 870024