




PANASONIC CHASSIS Euro-4

Models

TX21MD4 TX25MD4 TX25XD4/A TX25LD4DP
 TXW28R4 TXW28R4DP TXW28R4L
 TX28MD4 TX28MD4L TX28LD4DP
 TX28LD4DPL TX28XD4/A TX28XD4L/A

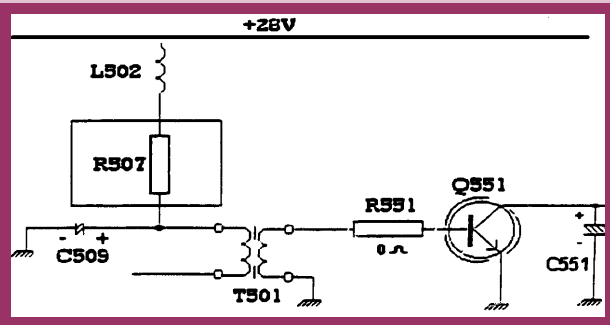

SUBJECT: Q551 Horizontal output transistor.

BACKGROUND: Possible failure of Q551 on 28" Euro 4 Models

REMEDY: Change transistor type and resistor value, in the following configurations only, using this kit.

NOTE: When replacing Q551 apply Heat Sink Compound between Q551 and heat sink.

A: Model TX21MD4 TX25MD4 TX25XD4/A TX25LD4DP
 Replace Q551 Part No BU2508AXLB with BU2508AXLB
 (No Change)

B: Model TXW28R4 TXW28R4DP TXW28R4L
 Replace Q551 Part No BU2508AXLB with 2SD1577LB

C: Model TX28MD4 TX28MD4L TX28LD4DP TX28LD4DPL
 TX28XD4/A TX28XD4L/A

1. Replace Q551 Part No BU2508AXLB with 2SD1577LB
2. Change value of R507 from 270 ohms 1watt Part No (ERG1FJ271) to 100 ohms 1watt Part No (ERG1FJ101)

Description	Order Code
Q551 Transistor BU2508AXLB	
Q551 Transistor 2SD1577LB	
R507 Resistor 100 ohm 1watt	
KIT ALL ABOVE ITEMS.	33000YR