

- 15) Adjust SUB-CONTRAST command to  $47 \pm 2FL$  of the color 15,0 box pattern (70x70mm) luminance at mode 4 and save in color 1.
- 16) Display color 15,0 full white patten at Mode 4.
- 17) COLOR ADJ. → LUMINANCE → ABL command.
- 18) Adjust ABL to  $31 \pm 1FL$  of the luminance.
- 19) Exit from the program.

### 5. Adjustment for Focus.

- 1) Set the Brightness and Contrast to max position.
- 2) Display H character in full screen at Mode 4.
- 3) Adjust two Focus control on the FBT that focus should be the best condition.

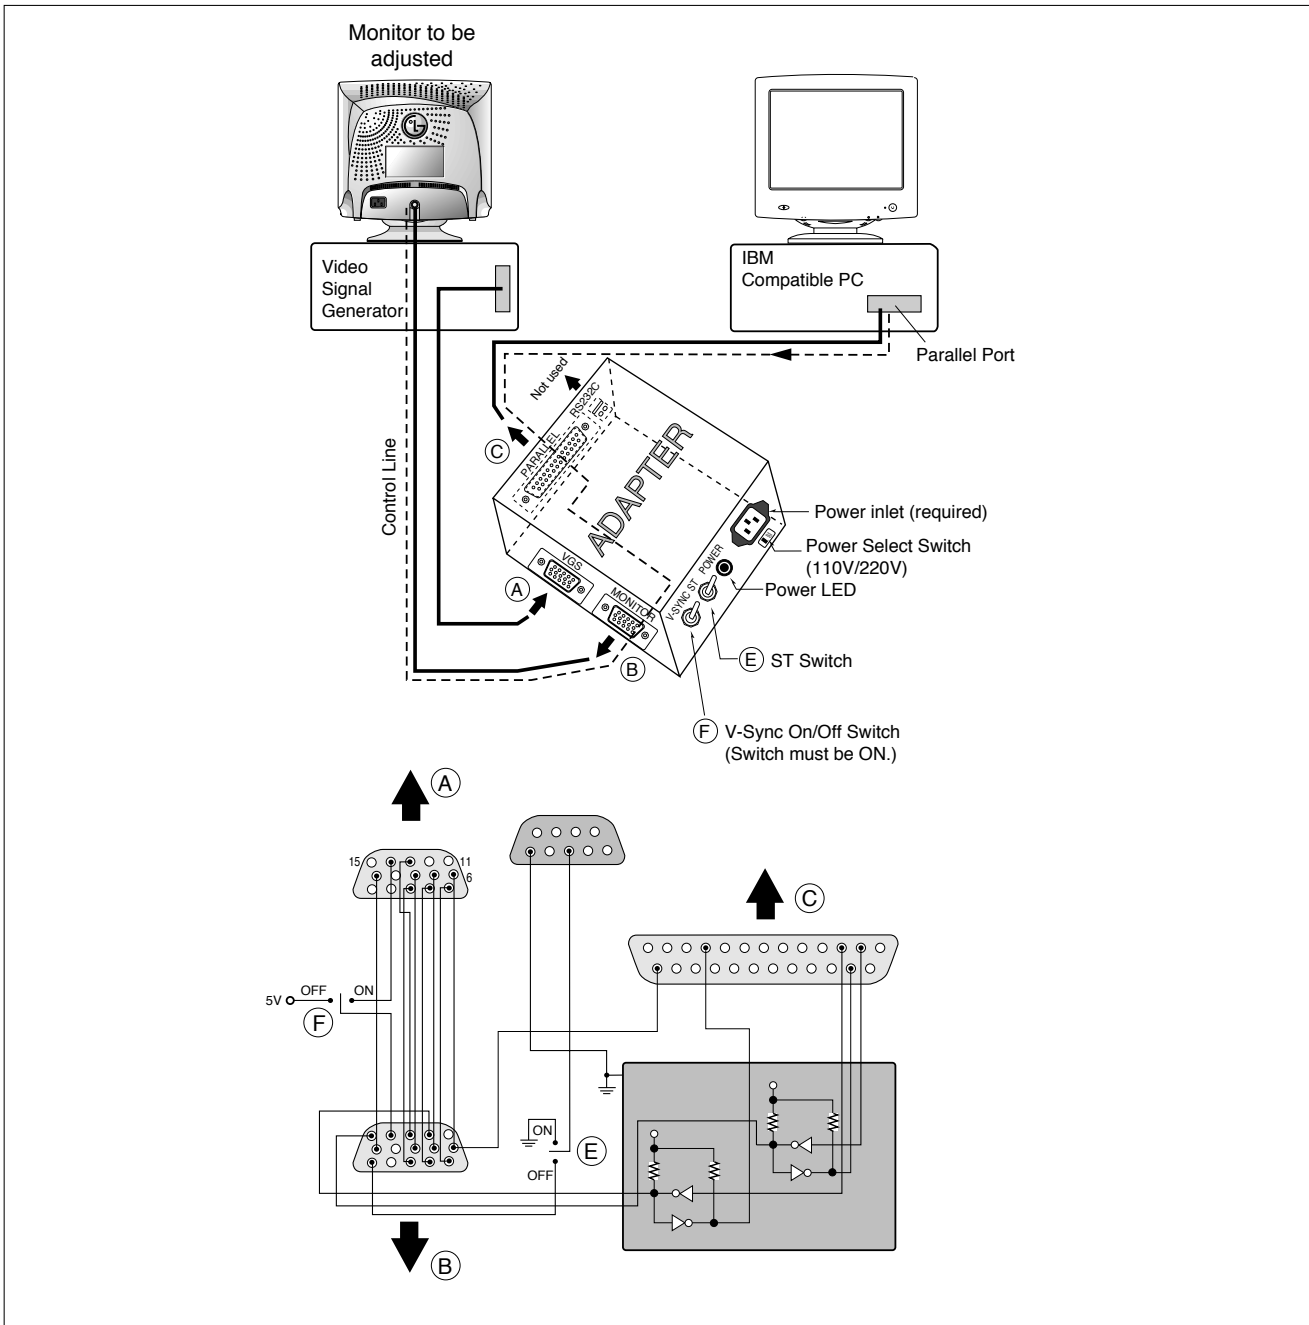


Figure 1. Cable Connection